PAGE: 1 PRINT DATE: 06/02/00

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- NON-CIL HARDWARE NUMBER:05-6PK-20300B -X

SUBSYSTEM NAME: EPD&C-COMMUNICATION & TRACKING:CLOSED CIRCUIT TV

REVISION: 0

PART DATA

PART NAME **VENDOR NAME** PART NUMBER **VENDOR NUMBER**

LRU :PANEL A7A1

V070-730356

SRU :SWITCH,TOGGLE

ME452-0102-7601

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

SWITCH TOGGLE S58 TO CONTROL POWER TO TRANSCEIVER

REFERENCE DESIGNATORS: 36V73A71-S58

QUANTITY OF LIKE ITEMS: 1

FUNCTION:

CONTROLS POWER TO RPC 35 IN MPCA3 WHICH POWERS THE WIRELESS VIDEO SYSTEM TRANSCEIVERS

REFERENCE DOCUMENTS: ECN 105-25016B DATED 3/25/99

PAGE 2 PRINT DATE: 06/02/00

FAILURE MODES EFFECTS ANALYSIS FMEA -- NON-CIL FAILURE MODE

NUMBER: 05-6PK-20300B-02

REVISION#: 0

05/31/00

SUBSYSTEM NAME: EPD&C-COMMUNICATION & TRACKING:CLOSED CIRCUIT TV

LRU: PANEL A7A1

CRITICALITY OF THIS

ITEM NAME: SWITCH, TOGGLE

FAILURE MODE: 1R3

FAILURE MODE:

SHORT-TO-CASE(GROUND)

MISSION PHASE:

LO LIFT-OFF

OO ON-ORBIT

DO DE-ORBIT

LS LANDING/SAFING

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY

104 ATLANTIS 105 ENDEAVOUR

CAUSE:

PIECE PART STRUCTURAL FAILURE, CONTAMINATION, VIBRATION, MECHANICAL SHOCK, PROCESSING ANAMOLY

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) PASS

B) PASS

C) PASS

PASS/FAIL RATIONALE:

A١

FAILURE MODE DETECTABLE BY TOGGLING THE SWITCH TO DETERMINE IF TRANSCEIVER IS POWERED OFF/ON

B)

OCCURRENCE OF THIS FAILURE MODE IS DETECTABLE IN A FLIGHT SINCE THE SHORT WOULD RESULT IN LOSS OF CONTROL BUS BC1.

C)

- FAILURE EFFECTS -

(A) SUBSYSTEM:

LOSS OF TRANSCEIVER POWER AND POSSIBLE LOSS OF CONTROL BUS BC1.

(B) INTERFACING SUBSYSTEM(S):

POSSIBLE LOSS OF CONTROL SIGNALS TO ANY SUBSYSTEMS USING BUS BC1.

PAGE: 3 PRINT DATE: 06/05/00

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- NON-CIL FAILURE MODE NUMBER: 05-6PK-20300B-02

(C) MISSION:

POSSIBLE LOSS OF MISSION AFTER THREE FAILURES SEE (D) FOR SCENARIO.

(D) CREW, VEHICLE, AND ELEMENT(S):

POSSIBLE LOSS OF CREW/VEHICLE AFTER THREE FAILURES:

- (1) TOGGLE SWITCH S58 SHORTS-TO-CASE (GROUND)
- (2) CURRENT LIMITING RESISTOR R2 SHORTS END-TO-END RESULTING IN POSSIBLE DAMAGE TO CONTROL BUS BC1. ALL CRITICAL FUNCTIONS ON BUS BC1 HAVE BACKUP.
- (3) LOSS OF NEXT CONTROL BUS MAY CAUSE LOSS OF CREW/VEHICLE.

(E) FUNCTIONAL CRITICALITY EFFECTS:

TOGGLE SWITCH S58 SHORTING TO GROUND MAY CAUSE LOSS OF CREW/VEHICLE.

- APPROVALS -

S & R ENGINEERING DESIGN ENGINEERING :K.E. RYAN/C.S. PUTCHA

:G.J. SCHWARTZ